- Correcting Agent Of Dyeing Troubles Like Dyestuff Spots

In occurrence of various dyeing troubles like dyestuff spot, the dyeing industry have undergone a burdensomeness that they had to do W/R and O/R processing again after removing a W/R agent and redyeing. **TR-101RX** is a correcting agent of dyeing troubles, which makes levelling dyeing without removing fluorocarbon-based water and oil repellent and damaging the processed state when various dyeing troubles were caused after W/R processing.

*** SPECIFICATION**

* APPEARANCE

* IONIC NATURE

* pH (1% aq. Sol'n)

* SP.GR(at 25°C)

* SOLUBILITY

* STORAGE STABILITY

* COMPATABILITY

Light Yellowish Liquid

Weak Anionic

 7.0 ± 1.0

 1.05 ± 0.05

Easily soluble in cold water.

Min. 1 year under cool and dry conditions

when stored in original sealed, packaging.

Compatible with anionic and nonionic materials.

• FEATURES

- TR-101RX displays good levelling effect on correcting the dyeing inferiority caused after W/R processing regardless of kinds of dyestuffs and fibers.
- TR-101RX can improve productivity, because it can easily correct the dyeing inferiority.
- 3) **TR-101RX** doesn't adversely affect W/R and O/R efficiency.
- 4) TR-101RX can cut down the cost.
- 5) TR-101RX has good storage stability.
- 6) It is environmental-friendly product as APEO-free and NPEO-free.

*** APPLICATION FIBERS**

Suitable for all fibers such as Nylon, Polyester, Cotton, T/C, N/C, N/P, etc.

HOW TO USE

Recommended use levels are 1-2g/ ℓ according to kinds, density, thickness and types of fibers.

Jalan Cheras, Batu5,56100, Kuala Lumpur, Malayasia Cell No: +601116622841, E-mail: info@rochemint.com, www.rochemint.com

- Correcting Agent Of Dyeing Troubles Like Dyestuff Spots

◆CORRECTING


DIAGRAM &

RECOMMENDED

RECIPE

When dyestuff spots is occured in testing process after Water/Oil
Repellent processing, it can be corrected easily by following process without
water-repellent removing.

TR-101RX

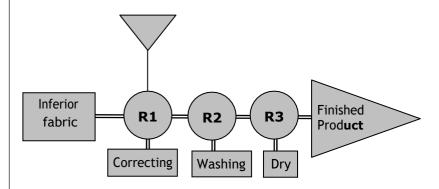

1) The correction method at normal pressure(Jigger)

• TR-101RX : 1-2g/\(\ell\)

• Correction conditions : Levelling for 4-6 cycles at 60-70°C

• Washing : Washing warm at 40-50°C and then cold.

• Dry : 50-60 m/min at 170-180°C

• Bath ratio : 1:4-1:5

Notice: TR-101RX residues after correction processing may impair
 W/R and O/R efficiency. Please thoroughly rinse.

2) The correction method at high pressure(Rapid)

• TR-101RX : 1-2g/\(\ext{l}

• Correction conditions : Levelling for 40-60 min at 60-70°C.

• Washing : Washing warm at 40-50°C and then cold.

• Dry : 50-60m/min at 170-180°C

• Bath ratio : 1:20-1:50

Notice: TR-101RX residues after correction processing may impair
 W/R and O/R efficiency. Please thoroughly rinse.

♦ PACKAGE

120 Kgs NET IN DRUMS.

Jalan Cheras, Batu5,56100, Kuala Lumpur, Malayasia Cell No: +601116622841, E-mail: info@rochemint.com, www.rochemint.com